11920 4 Hours / 100 Marks

Seat No.								
----------	--	--	--	--	--	--	--	--

Instructions:

- (1) All Questions are *compulsory*.
- (2) Answer each next main Question on a new page.
- (3) Illustrate your answers with neat sketches wherever necessary.
- (4) Figures to the right indicate full marks.
- (5) Assume suitable data, if necessary.
- (6) Use of Non-programmable Electronic Pocket Calculator is permissible.
- (7) Mobile Phone, Pager and any other Electronic Communication devices are not permissible in Examination Hall.

Marks

1. (a) Attempt any THREE of the following:

12

- (i) Explain Factor Of Safety (FOS). Write four factors on which FOS depends.
- (ii) Explain the purpose of turn buckle. State its application.
- (iii) A shaft is required to transmit 1 MW power at 240 rpm. The shaft must not twist more than 1 degree on a length of one meter. If the modulus of rigidity for the material of shaft is 80 kN/mm². Find the diameter of shaft and shear stress induced on it.
- (iv) Explain self locking and over-hauling of power screws.

[1 of 4] P.T.O.

17610	[2 of 4]
-------	----------

(b) Attempt any ONE:

		(i)	State & explain the steps involved in general design procedure.	
		(ii)	A flange coupling is used to transmit 20 kW power at 700 rpm. The flanges are of cast iron and other parts are of mild steel. Determine diameter of shaft, diameter of bolts assuming number of bolts are 6 and	
			flange dimension.	
			Take – (1) Shear stress for mild steel = 40 N/mm^2	
			(2) Shear stress for cast iron = 10 N/mm^2	
			(3) Tensile & crushing stress = 100 N/mm ²	
2.	Atte	mpt a	ny TWO of the following:	16
	(a)		gn a knuckle joint to transmit 150 kN power. The design stresses may be as 75 MPa in tension, 60 MPa in shear and 150 MPa in compression.	
	(b)	exte	pare the weight, strength and stiffness of a hollow shaft of the same mal diameter as that of solid shaft. The inside diameter of hollow shaft g half the external diameter. Both the shaft have the same material and th.	
	(c)	(i)	Define:	
			(1) Ductility (2) Stiffness (3) Elasticity (4) Malleability	4
		(ii)	Draw a neat sketch of hand lever. Why levers are tapered at the ends?	4
3.	Atte	mnt a	ny FOUR of the following:	16
•	(a)	-	gest suitable material for the following machine parts:	10
	()	(i)	Crank shaft	
		(ii)	Helical spring	
		(iii)	Bushes for knuckle pin	
		(iv)	Lathe bed	

06

17610 [3 of 4]

- (b) Why taper is provided on cotter? State its normal value. Write two application of cotter joint.
- (c) Write design procedure for sunk key.
- (d) Compare welded joints with screwed joint. (any four points)
- (e) Explain the gear tooth failure modes: (i) scoring (ii) pitting

4. (a) Attempt any THREE of the following:

12

- (i) Define Ergonomics. State area covered under ergonomics.
- (ii) Define following terms with respect to springs: (1) Free length(2) Solid length (3) Spring stiffness (4) Spring index
- (iii) How the keys are classified? State the function of keys.
- (iv) State any four advantages & disadvantages of welded joint over riveted joint.

(b) Attempt any ONE of the following:

06

- (i) Write design consideration for spur gear.
- (ii) Define endurance limit. Draw and explain typical S N curve for steel.

5. Attempt any TWO of the following:

16

- (a) The lead screw of a lathe has square threads of 24 mm outside diameter and 5 mm pitch. In order to drive the tool carriage, the screw exerts an axial thrust of 2.5 kN find the efficiency of the screw and the power required to drive the screw if it is rotate at 30 rpm. Neglect the bearing friction. Assume co-efficient of thread friction as 0.12.
- (b) Design a helical compression spring for maximum load of 800 N for a deflection of 25 mm. The spring index is 5 and Wahl's correction factor is 1.3. The maximum permissible shear stress for the spring wire is 400 MPa. and modulus of rigidity is 84 kN/mm².

P.T.O.

- (c) (i) Give classification of bearing.
 - (ii) Draw different types of thread profiles used for power screw. Write one application of each.

4

4

6. Attempt any FOUR of the following:

16

- (a) A wall bracket is attached to a wall by means of four bolts, two at a distance of 50 mm from the lower edge and remaining two at a distance of 450 mm from the lower bolts. It supports a load of 50 kN at a distance of 500 mm from the wall. Find the diameter of bolts. Assume working stress in tension as 80 N/mm².
- (b) Explain with neat sketch construction details of leaf spring.
- (c) Explain with neat sketch the bolts of uniform strength.
- (d) Explain the procedure of selection of ball bearing using manufacturer's catalogue.
- (e) Define the following terms related to ball bearing:
 - (i) Basic static load rating
 - (ii) Basic dynamic load rating



(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

WINTER - 19 EXAMINATION

17610 **Subject Name: Design of Machine Elements Model Answer Subject Code:**

Important Instructions to examiners:

- 1) The answers should be examined by key words and not as word-to-word as given in the model answer scheme.
- 2) The model answer and the answer written by candidate may vary but the examiner may try to assess the understanding level of the candidate.
- 3) The language errors such as grammatical, spelling errors should not be given more Importance (Not applicable for subject English and Communication Skills.
- 4) While assessing figures, examiner may give credit for principal components indicated in the figure. The figures drawn by candidate and model answer may vary. The examiner may give credit for any equivalent figure drawn.
- 5) Credits may be given step wise for numerical problems. In some cases, the assumed constant values may vary and there may be some difference in the candidate's answers and model answer.
- 6) In case of some questions credit may be given by judgement on part of examiner of relevant answer based on candidate's understanding.
- 7) For programming language papers, credit may be given to any other program based on equivalent concept.

Q. No.	Sub Q. N.		Marking Scheme
1.		Attempt any THREE of the following	12 marks
	(a)	Factor of safety is a ratio of maximum stress withstand by an object to applied stress.	
		Whenever a Factor of safety is greater than or equal to, then the applied stress is less than or equal to the maximum stress so the object can withstand load. But when the ratio is equal to 1, the object tough enough to withstand load.	
		Whenever a Factor of safety is less than 1, the applied stress is greater than maximum stress then the object can't withstand the stress applied it leads to failure.	02
		The high factor of safety results in unnecessary risk of failure.	
		There are many factors as	
		1- materials strength (if the materials is a brittle or ductile)	
		2-possible misuse: the designer must consider any responsible of for foreseeable use	
		3-loading (static. impact, repeated).	
		4- complexity of stress analysis	
		5-cost	02
		6-environment and temperature, and this factor affect also to choose the materials.	
		and we can say also each factor from the previous factors affects on another one its like a network and the designer person must know this Entanglement perfectly	
	(b)	A turnbuckle, stretching screw or bottle screw is a device for adjusting the tension or length of ropes, cables, tie rods, and other tensioning systems. It normally consists of two threaded eye bolts, one screwed into each end of a small metal frame, one with a left-hand thread and the other with a right-hand thread.	Explaination- 02 Marks
		Applications – WWW Truexams com	



(Autonomous)

(ISO/IEC - 27001 - 2013 Certified)

- 1			
		i)Aircraft-Turnbuckles have been used in aircraft construction, especially during the early years of aviation.	
		ii)Shipping-Turnbuckles are used for tensioning a ship's rigging and lashings. This device is also known as a bottle screw	Applications
		iii)Sports-Turnbuckles find common use to tension the ropes in professional wrestling rings and boxing rings, where they serve as the attachment between the ring ropes and ring posts.	any 4 ½ M each
		iv)Entertainment industry-Turnbuckles are used in nearly all rigging performed in the entertainment industry, including theatre, film, and live concert performances.	
		v)Pipe systems-Turnbuckles are used in piping systems as a way to provide minor adjustments for field inconsistencies.	
		vi)Orthopaedics-A type of splint is used for upper limb to produce gradual stretching over contracted joint by its turn buckle mechanism.	
		vii)Buffers and chain coupler	
		viii)Guy-wire	
		ix)Mechanical joint	
	(c)	Torque transmitted by the shaft T= $Px60/2\pi$ N= $1X10^6X60/2\pi$ x240= 39783.58 Nm	
		$=39783.58 \times 10^{3} \text{ N.mm}$	01
		We know that $T/J=G\Theta/L$ or $J=TXL/GX\Theta$	01
		$\pi/32xd^4 = 39783.58x10^3x1000/80x10^3x0.0174 = 28580158$	01
		$d^4 = 28580158x32/\pi = 291077357$	
		d=103.73 mm say110mm=130.74mm Say 135mm	01
		Shear stress induced in the shaft	
		Torque transmitted by the shaft $T = \pi/16 \times \tau \times d^3 =$	
		put d=135mm	01
		$39783.58 \times 10^3 = \pi/16 \times \tau \times (110)^3$	U1
		$\tau = 148.15 \text{N/mm}^2 = 148.15 \text{ MPa} = 82.36 \text{MPa}$	
	(d)	Self locking property - torque required to lower the load, T= Wtan(φ - α) x d/2	
		Self locking property of the threads-if $\varphi > \alpha$ the torque required to lower the load will be positive, indicating that an effort is applied to lower the load. if friction angle is greater than the helix angle or coefficient of friction is greater than the tangent of helix angle	2 Mark for each
		Over hauling of screws in the above expression, if $\phi < \alpha$, then the torque required to lower the load will be negative. The load will start moving downward without the application of any torque, such a condition is known as over hauling of screws.	defination
1.	b	Attempt any ONE of the following	06 marks
	(i)	1. Recognition of need. First of all, make a complete statement of the problem, indicating the need, aim or purpose for which the machine is to be designed.	
		2. Synthesis (Mechanisms). Select the possible mechanism or group of mechanisms which	

www.truexams.com

(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

	will give the desired metion	
	will give the desired motion.	
	3. Analysis of forces. Find the forces acting on each member of the machine and the energy transmitted by each member.	02 MJ.
	4. Material selection. Select the material best suited for each member of the machine. 5. Design of elements (Size and Stresses). Find the size of each member of the machine by considering the force acting on the member and the permissible stresses for the material used. It should be kept in mind that each member should not deflect or deform than the permissible limit.	03 Mark
	6. Modification. Modify the size of the member to agree with the past experience and judgment to facilitate manufacture. The modification may also be necessary by consideration of manufacturing to reduce overall cost.	
	7. Detailed drawing. Draw the detailed drawing of each component and the assembly of the machine with complete specification for the manufacturing processes suggested. Prepare assembly drawing giving part numbers, overall dimensions and part list. The component drawing is supplied to the shop flow for manufacturing purpose, while assembly drawing is supplied to the assembly shop	
	8. Production. The component, as per the drawing, is manufactured in the workshop	
	Need or Aim	
	Synthesis (Mechanisms)	
	Analysis of forces Material selection	
	Design of elements (Size and stresses)	03 Mark
	Modification	
	Detailed drawing	
	Production	
(ii)	1. To find torque acting on the shaft	
	$T = Px60/2\pi N = 20 \times 10^3 \times 60/2 \pi \times 700 = 272.80 \text{ Nm} = 272.80 \times 10^3 \text{ Nmm}$	01
	2. To find diameter of shaft to transmit required torque	
	$T = \pi/16 \times \tau \times d^3$	
	$272.80 \times 10^3 = \pi/16 \times \tau \times d^3$	
	d ³ =32.62 mm say 35 mm	01
	Check shear stress in hub	
	Outside dia. of hub D=2d =2x35=70mm	01
	$T = \pi/16 \text{ x } \tau_c \text{ xd}^3 \text{x} (1-\text{k}^4) = \pi/16 \text{ x } \tau_c \text{ xD}^3 \text{x} (1-\text{k}^4)$	
	www.truexams.com	
	Page No:	/ N



(Autonomous)

(ISO/IEC - 27001 - 2013 Certified)

		Put the value D=70mm instead of d=35mm	01
		$272.80 \times 10^3 = \pi/16 \times \tau_c \times 35^3 \times (1-0.5^4)$	
		$\tau_c = 37.03 \text{N/mm}^2 = 4.32 \text{N/mm}^2$	01
		since induced stress is less than allowable shear stress	
		Design Of Bolts	
		No of Bolts n=6	01
		Pcd of bolts $D_1 = 3d = 3x35 = 105 \text{ mm}$	
		Torque transmitted $T = \pi/4 \ x(d_1)^2 x \ \tau_b \ xnxD_1/2$	
		$d_1 = 5.25 \text{ mm}$	
		nearest standard core diameter of bolt from coarse thread is 5.7773mm	
2.		Attempt any <u>TWO</u> of the following	16 marks
	(i)	1. Failure of the solid rod in tension	
		Let d = Diameter of the rod.	
		We know that the load transmitted (P),	
		$150 \times 10^3 = \pi/4 x d^2 x \ \sigma_t = \pi/4 x d^2 x \ 75$	
		$= 59 d^2$	
		$d^2 = 150 \times 103 / 59 = 2540 \text{ or } d = 50.4 \text{ say } 52 \text{ mm Ans.}$	
		Now the various dimensions are fixed as follows:	
		Diameter of knuckle pin,	
		$d_1 = d = 52 \text{ mm}$	
		Outer diameter of eye, $d_2 = 2$ $d = 2 \times 52 = 104$ mm	
		Diameter of knuckle pin head and collar,	
		$d_3 = 1.5 d = 1.5 \times 52 = 78 mm$	
		Thickness of single eye or rod end,	
		$t = 1.25 d = 1.25 \times 52 = 65 mm$	02 M
		Thickness of fork, t	
		$1 = 0.75 \text{ d} = 0.75 \times 52 = 39 \text{ say } 40 \text{ mm}$	
		Thickness of pin head, $t_2 = 0.5 d = 0.5 \times 52 = 26 mm$	
		2. Failure of the knuckle pin in shear	
		Since the knuckle pin is in double shear, therefore load (P),	
		$150 \times 10^3 = 2x \pi/4(d_1)^2 x \tau$	
		$\therefore \tau = 150 \times 10^3 / 4248 = 35.3 \text{ N/mm}^2 = 35.3 \text{ MPa}$	
		3. Failure of the single eye or rod end in tension	
	1	WWW.truexams.com Page No:	/ N



(Autonomous)

	(ISO/IEC - 27001 - 2013 Certified)	
	The single eye or rod end may fail in tension due to the load. We know that load (P),	
	$150 \times 10^3 = (d_2 - d_1) t \times \sigma_t$	
	$= (104 - 52) 65 \times \sigma_t = 3380 \sigma_t$	
	$ \label{eq:sigmatilde} \div \ \sigma_t \! = 150 \times 10^3 \ / \ 3380 = 44.4 \ N \ / \ mm^2 \! = 44.4 \ MPa $	
	4. Failure of the single eye or rod end in shearing	
	The single eye or rod end may fail in shearing due to the load. We know that load (P),	
	$150 \times 10^3 = (d_2 - d_1) t \times \tau = (104 - 52) 65 \times \tau = 3380 \tau$	02 M
	5. Failure of the single eye or rod end in crushing	
	The single eye or rod end may fail in crushing due to the load. We know that load (P),	
	$150\times10^3=d_1\times t\times\sigma_c$	
	$=52\times65\times\sigma_{\rm c}=3380~\sigma_{\rm c}$	
	6. Failure of the forked end in tension	
	The forked end may fail in tension due to the load. We know that load (P),	
	$150 \times 10^{3} = (d_{2} - d_{1}) \ 2 \ t_{1} \times \sigma_{t}$	
	$= (104 - 52) \ 2 \times 40 \times \sigma_{t} = 4160 \ \sigma_{t}$	
		02 M
	7. Failure of the forked end in shear	
	The forked end may fail in shearing due to the load. We know that load (P)	
	$150 \times 10^3 = (d_2 - d_1) \ 2 \ t_1 \times \tau = (104 - 52) \ 2 \times 40 \times \tau = 4160 \ \tau$	
	8. Failure of the forked end in crushing	
	The forked end may fail in crushing due to the load. We know that load (P),	
	$150\times10^3 = d_1\times2\ t_1\times\sigma_c$	
	$=52\times2\times40\times\sigma_{c}~=4160~\sigma_{c}$	02 M
	$ \ \div \sigma_c = 150 \times 10^3 / 4180 = 36 \text{N/mm}^2 = 36 \text{MPa} $	02 111
	From above, we see that the induced stresses are less than the given design stresses, therefore the joint is safe.	
(ii)	Given: do = d;	
	di = do / 2 or k = di / do = 1 / 2 = 0.5	
	Comparison of weight	
	www.truexams.com	_
	Page No:	/ N



(Autonomous) (ISO/IEC - 27001 - 2013 Certified)


	www.truexams.com	
	3) Elasticity -The elasticity of a material or substance is its ability to return to its original shape	1 Mark
	2) Stiffness -It is defined as the property of a material which is rigid and difficult to bend. The example of stiffness is rubber band.	1 Mark
(iii) a)	1) Ductility is the physical property of a material associated with the ability to be hammered thin or stretched into wire without breaking. A ductile substance can be drawn into a wire. Examples: Most metals are good examples of ductile materials, including gold, silver, copper, erbium, terbium, and samarium.	1 Mark
	$= 1 - k^4 = 1 - (0.5)^4 = 0.9375$ Ans.	
	$S_H/S_S = G/Lx \pi/32 [(do)4-(di)4]/G/Lx \pi/32xd^4(d = do)$	
	Dividing equation (v) by equation (vi), we get	
	$S_S = G/Lx \pi/32xd^4(vi)$	02 M
	and stiffness of a solid shaft,	
	$S_H = G/Lx \pi/32 [(do)^4-(di)^4](v)$	
	∴ Stiffness of a hollow shaft,	
	$= T/\theta = G J/L$	
	We know that stiffness	
	Comparison of stiffness	
	= 1 - (0.5)4 = 0.9375 Ans.	
	$= 1 - k^4$ (d = do)	02 M
	$T_H/T_S == \pi/16 \times \tau(do)3 - (di)3 (1-k4)3/\pi/16x \tau \times d3$	
	Dividing equation (iii) by equation (iv), we get	
	$T_S = \pi/16x \ \tau \times d^3(iv)$	
	and strength of the solid shaft,	
	$T_{\rm H} = \pi/16 \times \tau(\text{do})^3 - (\text{di})^3 (1-k^4)^3 (iii)$	
	We know that strength of the hollow shaft,	
	Comparison of strength	02 M
	$= 1 - k^2 = 1 - (0.5)2 = 0.75 \text{ Ans.}$	
	equation (ii), we get $W_{H}/W_S = \pi/4 \left[(do)^2 - (di)^2 \right] / \pi/4xd^2$	
	Since both the shafts have the same material and length, therefore by dividing equation (i) by	
	$W_S = \pi/4xd^2 \text{ xLength} \times \text{Density }(ii)$	
	and weight of the solid shaft,	
	$= \pi/4 [(do)^{2-}(di)^{2}] \times Length \times Density(i)$	02 111
	$W_H = Cross\text{-sectional area} \times Length \times Density$	02 M



(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

		4) Malleability is a substance's ability to deform under pressure (compressive stress). If	
		malleable, a material may be flattened into thin sheets by hammering or rolling.	1 Mark
	b)	Hand Lever Bearing Shaft	
		Boss	2 Mark
		In lever, the bending moment is maximum at the fulcrum and minimum at the ends. Therefore, the levers are usually tapered from the fulcrum to the ends. This would help in saving the material at the ends. Lever with fulcrum between load and effort.	2 Mark
		Bending moment is zero at the point of application of load. So the resisting area at this point is minimum and maximum, where the bending takes place. So levers are tapered to avoid stress concentration.	
3.		Attempt any FOUR of the following	16 marks
	(a)	Suggest suitable material for the following machine parts.	
	Ans	i)Crank Shaft : Alloy steel 20Mn2 , 35 Mn2MO28	
		ii)Helical spring : oil tempered carbon steel / chromium vanadium alloy steel	1 Mark each
		iii)bushes for knuckle pin: Phosphorus bronze, Grey C.I	
		iv)Lathe bed: Grey cast iron like FG150	
	(b)	Why taper is provided on taper? State the normal value. Write any two application of cotter joint.	
	Ans	i)When cotter is driven through the slots, it fit, fight due to wedge action. This ensures tightness of joint in operation and present loosening of the parts.ii) Due to taper, it is easy to remove the cotter and dismantle the joint.	Reason: 2 M
		The normal value of taper varies from 1 in 48 to 01 in 24 and it may increase to 1 in 8.	Value : 1M
		Application of cotter joint: 1) Lewis foundation bolt 2) connection of the piston rod to	Application:
		cross head of a reciprocating steam engine. 3) Valve rod & its stem 4) piston rod to the trail end in an air pump. 5) Cycle pedal sprocket wheel.	1M
	(c)	Write the design procedure of sunk key	
	Ans	www.truexams.com	

(Autonomous)

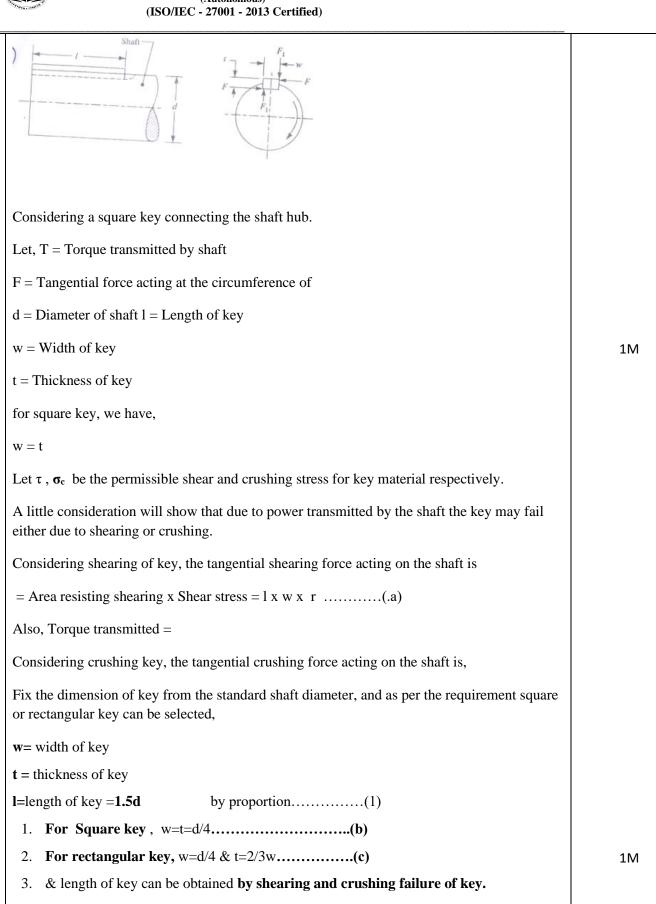

(2)

Considering shearing of key,

 $T=\tau \times w \times 1 \times d/2$

1M



(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

	Considering crushing failure of key,	1M
	$T = \sigma_c \times l \times d/2 \times t/2$ (3)	
(d)	Compare welded joints with screwed joints. (Any Four Pints)	
Ans	(i) Screwed joints require additional elements like washers and a large number of nut bolts, which increase the weight. Since there are no such additional parts, welded assembly results in lightweight construction. Welded steel structures are lighter compared to	1 M each
	threaded joints. (ii) Due to the elimination of these components, the cost of welded assembly is lower than	1 W Cacii
	that of screwed joints.	
	(iii) The design of welded assemblies can be easily and economically modified to meet the	
	Changing product requirements. Alterations and additions can be easily made in the existing	
	structure by welding.	
	(iv) Welded assemblies are tight and leak-proof as compared with screwed assemblies. Welded assemblies are tight and leak-proof as compared with screwed assemblies.	
(e)	Explain the gear tooth failure modes 1) scoring 2) pitting	
Ans	i) SCORING:	
	Scoring is due to combination of two distinct activities: First, lubrication failure in	
	The contact region and second, establishment of metal to metal contact.	2 M
	 Later on, welding and tearing action resulting from metallic contact removes the metal rapidly and continuously so far the load, speed and oil temperature remain at the same level. 	
	The scoring is classified into initial, moderate and destructive.	
	ii) Pitting:	
	This is a major cause of gear failure accounting for nearly 60% of the gear failures.	
	 Pitting is the formation of craters on the gear tooth surface. These craters are formed due to the high amount of compressive contact stresses in the gear surface occurring during transmission of the torque or in simple terms due to compressive fatigue on the gear tooth surface. 	2 M
	 The pitting starts when total load acting on the gear tooth exceeds the wear strength of the gear tooth. 	
. A	Attempt any THREE of the following	12 marks
	Define Ergonomics .state areas covered under ergonomics	
(a)		

www.truexams.com



(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

machine relationship. Following areas are covered under ergonomics: The relation between man and machine Areas: 2M The working environment The human anatomy and posture while using the machine The energy expenditure in hand and foot operations **(b)** Define the following terms with respect to spring Ans 1) Free length: is the length of the spring in the free or unloaded condition. It is equal to the solid length plus the maximum deflection or compression of the spring and 1 M each term the clearance between the adjacent coils Free length of the spring, L_F = Solid length + Maximum compression + *Clearance between adjacent coils $L_F = n'.d + \delta_{max} + 0.15 \delta_{max}$ 2) Solid length: The solid length of a spring is the product of total number of coils and the diameter of the wire. Mathematically, Solid length of the spring, $L_S = n'.d$ where n' = Total number of coils, and d = Diameter of the wire 3) Spring stiffness: The spring stiffness or spring constant is defined as the load required per unit deflection of the spring. Mathematically, Spring rate, $k = W / \delta$ Where, W = Load, and δ = Deflection of the spring. 4) Spring index: The spring index is defined as the ratio of the mean diameter of the coil to the diameter of the wire. Mathematically, Spring index, C = D / d where D = Mean diameter of the coil, and d = Diameter of the wire. (c) How the keys are classified? State the function of keys. Ans Keys are classified as follows 1) Sunk Key: a) Rectangular sunk key b) square sunk key c) Gib head key d) feather key Classification:2M e) Woodruff key

www.truexams.com



(Autonomous)

(ISO/IEC - 27001 - 2013 Certified)

	3) Round key	
	4) Splines	
	Functions of Key:	
	a) To transmit torque from shaft to hub of mating element such as pulley, gear etc.	Fun: 2 M
	b)To prevent relative motion between the shaft & mating machine element	
(d)	State any four advantages & disadvantages of welded joints over riveted joint	
Ans	Advantages:	
	 The welded structures are usually lighter than riveted structures. This is due to the reason, that in welding, gussets or other connecting components are not used. The welded joints provide maximum efficiency (may be 100%) which is not possible in 	
	case of riveted joints. 3. Alterations and additions can be easily made in the existing structures.	1 M each
	4. As the welded structure is smooth in appearance, therefore it looks pleasing.	
	5. In welded connections, the tension members are not weakened as in the case of riveted joints.	(Any four p
	6. A welded joint has a great strength. Often a welded joint has the strength of the parent	
	metal itself. 7. Sometimes, the members are of such a shape (<i>i.e.</i> circular steel pipes) that they afford difficulty for riveting. But they can be easily welded.	
	8. The welding provides very rigid joints. This is in line with the modern trend of providing rigid frames.	
	9. It is possible to weld any part of a structure at any point. But riveting requires enough clearance.	
	10. The process of welding takes less time than the riveting.	
В	Attempt any ONE of the following	06 marks
(a)	Write the design consideration for spur gear	
Ans	1) The power to be transmitted	1 M each
Ans	2) The velocity ration or speed of gear drive.	1 M each
Ans	2) The velocity ration or speed of gear drive.3) The central distance between the two shafts	1 M each
Ans	2) The velocity ration or speed of gear drive.3) The central distance between the two shafts4) Input speed of the driving gear.	1 M each
Ans	 The velocity ration or speed of gear drive. The central distance between the two shafts Input speed of the driving gear. Wear characteristics of the gear tooth for a long satisfactory life. 	1 M each
Ans	 The velocity ration or speed of gear drive. The central distance between the two shafts Input speed of the driving gear. Wear characteristics of the gear tooth for a long satisfactory life. The use of space & material should be economical. 	1 M each
Ans	 The velocity ration or speed of gear drive. The central distance between the two shafts Input speed of the driving gear. Wear characteristics of the gear tooth for a long satisfactory life. The use of space & material should be economical. 	1 M each
	 The velocity ration or speed of gear drive. The central distance between the two shafts Input speed of the driving gear. Wear characteristics of the gear tooth for a long satisfactory life. The use of space & material should be economical. Efficiency & speed ratio Cost 	1 M each Def:
(b)	 The velocity ration or speed of gear drive. The central distance between the two shafts Input speed of the driving gear. Wear characteristics of the gear tooth for a long satisfactory life. The use of space & material should be economical. Efficiency & speed ratio Cost Define endurance limit .Draw and explain typical S-N curve for the steel. 	

www.truexams.com

(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

	100	Low High cycle Sut Finite life Infinite life Infinite life Infinite life Infinite life Infinite life Infinite life Number of stress cycles N	Sketch 2 M
	as ind	e plot of fatigue strength Sf Vs stress cycle N on log paper. This plot is popularly is known S-N Diagram .For the steel material ,the graph becomes horizontal at 10 ⁶ cycles, licating that the fatigue failure will not occurs below this stress, whenever may the mber of cycles. This stress is known as endurance limit Sf of the material.	Explain 2M
5.	Att	tempt any <u>TWO</u> of the following	16 marks
5.	ord of t	e lead screw of a lathe has square threads of 24 mm outside diameter and 5 mm pitch. In ler to drive the tool carriage, the screw exerts an axial thrust of 2.5 kN find the efficiency the screw and the power required to drive the screw if it is rotate at 30 rpm. Neglect the aring friction. Assume co-efficient of thread friction as 0.12	8 marks
A	ns W	$= 2.5 \text{ kN} = 2.5 \times 10^3 \text{ N}.$	
	Ou	tside Diameter = $d_0 = 24$ mm.	
	Pite	ch = p = 5 mm.	
	tan	$\mathbf{n} \emptyset = \mu = 0.12$	
	N =	= 300 rpm.	
	Ins	side Diameter $= d_c = d_o - p = 24 - 5 = 19 \text{ mm}.$	
	Me	ean Diameter = $D_m = \frac{d_o + d_c}{2} = \frac{24 + 19}{2} = 21.5 mm$.	01 Mark
	tan	$\alpha = \frac{p}{\pi \cdot D_m} = \frac{5}{\pi \times 21.5} = 0.074$	01 Mark
	α =	= 4.232°	
	Ø =	$= \tan^{-1} \mu = \tan^{-1}(0.12)$	Ol Mada
	Ø =	= 6.8427°	01 Mark
	To	rque required to overcome the friction,	01 Mark
	T_1	$=W \tan(\emptyset + \alpha) \frac{D_m}{2}$	
		www.truexams.com	/ N

(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

	$= 2.5 \times 10^3 \times \tan(6.84 + 4.232) \times \frac{21.5}{2}$	
	= 5259.027 N. mm = 5.259 N. m	02 Mark
	Power required to drive the screw (P),	
	$P = \frac{2\pi NT}{60} = \frac{2\pi \times 30 \times 5259.3027}{60} = 16.521 Watt.$	
	Efficiency of the screw,	
	$ \eta_s = \frac{\tan \alpha}{\tan(\alpha + \emptyset)} = \frac{0.074}{\tan(4.232 + 6.84)} = 0.3910 = 39.10\% $	02 Mark
(b)	Design a helical compression spring for maximum load of 800 N for a deflection of 25 mm. The spring index is 5 and Wahl's correction factor is 1.3. The maximum permissible shear	8 marks
	stress for the spring wire is 400 MPa. And modulus of rigidity is 84 kN/mm ² .	


www.truexams.com

(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

***	(ISO/IEC - 27001 - 2013 Certified)	
Ans	Given: W = load = 800 N	
	Deflection = $\delta = 25 \text{ mm}$	
	Spring index = $C = 5$	
	Wahl's factor = $K_w = 1.3$	
	Shear stress induced = τ = 400 MPa	
	Modulus of rigidity = $G = 84 \times 10^3 \text{ N/mm}^2$	
	Shear stress induced = $\tau = K_w \times \frac{8WC}{\pi \times d^2}$	
	$400 = 1.3 \times \frac{8 \times 800 \times 5^{3}}{\pi d^{2}}$	
	Wire diameter = $d = 5.75 \approx 6 \text{ mm}$	01 Mark
	Deflection of spring = $\delta = \frac{8W C^3}{G \times d} \times n$	
	$n = \frac{G \times d \times \delta}{8 \times W \times C^3}$	
	$=\frac{25\times84\times10^3\times6}{8\times800\times5^3}$	01 Mark
	Active turn = $n = 15.75 \cong 16$	
	Assuming square and ground end,	
	Total number of turn $n' = n + 2 = 16 + 2 = 18$	_
	Free length of spring	01 Mark
	$= n'd + \delta_{max} + 0.15 \times \delta_{max}$	
	$= 18 \times 6 + 25 + 0.15 \times 25 = 136.75 \text{ mm}$	01 Mark
	pitch of spring = p = $\frac{\text{free length}}{n'-1} = \frac{136.75}{18-1} = 8.04 \text{ mm}$	
	For mean coil diameter, $C = \frac{D_m}{d}$	01 Mark
	Mean coil diameter $D_m = 6 \times 5 = 30$	01 Mark
	Outer diameter of coil = $D_0 = D_m + d = 30 + 6$	
	= 36 mm	01 Mark
	Inner diameter of coil = $D_i = D_m - d = 30 - 6$	
	= 24 mm	01 Mark
1		

(Autonomous)

(ISO/IEC - 27001 - 2013 Certified)

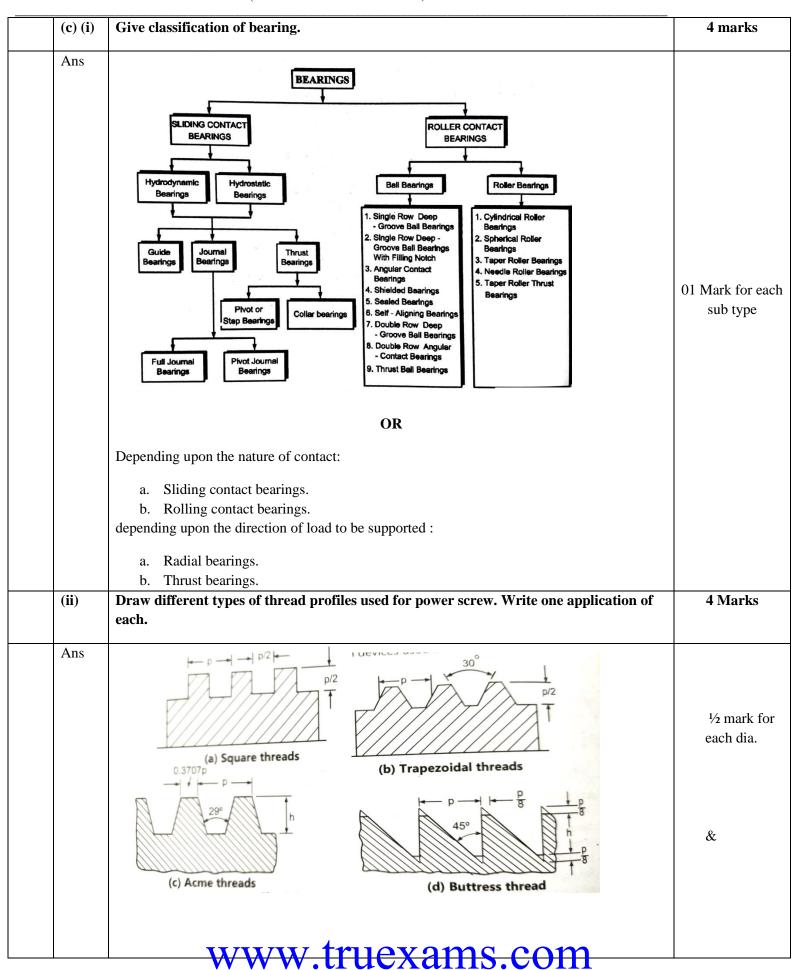



(Autonomous)

N . IVO	(ISO/IEC - 27001 - 2013 Certified)	
pplic	ations:	
1.	Square threads:	
	i Corow inche	

		Applications:	
		1. Square threads:	
		i. Screw jacks,	
		ii. Mechanical press,	½ mark for
		iii. Clamping devices.	each type
		2. Acme threads:	application
		i. Used in lead screw of machine tools,	
		ii. Brass valves,	
		iii. Cocks,	
		iv. Bench vices.	
		3. Trapezoidal threads:	
		i. Lead screws, etc	
		4. Buttress threads:	
		i. Artillery,	
		ii. Breechblock, etc.	
6		Attempt any FOUR of the following	16 Marks
6	(a)	A wall bracket is attached to a wall by means of four bolts, two at a distance of 50 mm from	04 Marks
		the lower edge and remaining two at a distance of 450 mm from the lower bolts. It supports a	
		load of 50 kN at a distance of 500 mm from the wall. Find the diameter of bolts. Assume	
		working stress in tension as 80 N/mm ² .	

www.truexams.com

(Autonomous)

(ISO/IEC - 27001 - 2013 Certified)


Given: $\sigma_t = 80 \text{ N/mm}^2$

Load = W =
$$50 \text{ kN} = 50 \times 10^3 \text{ N}$$

L = 500 mm

 $L_1 = 50 \text{ mm}$

 $L_2 = 50 + 450 = 500 \text{ mm}$

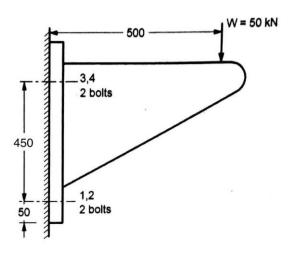

Number of bolt = n = 04

From Fig. P. 4.16.3, load is perpendicular to the axis of bolt

1. Direct shear load (W_s)

$$W_s = \frac{W}{n} = \frac{50 \times 10^3}{4}$$

$$W_s = 12500 \text{ N} = 12.5 \text{ kN}$$

 Maximum tensile load carried by bolt 3 and 4 at a distance L₂.

As load 'W' will try to tilt the bracket in the clockwise direction, the bolt, 3 and 4 is at greatest distance about tilting edge.

:. Maximum tensile load (W,)

$$W_{t} = \frac{WL L_{2}}{2 [L_{1}^{2} + L_{2}^{2}]} = \frac{50 \times 10^{3} \times 500 \times 500}{2 [(50)^{2} + (500)^{2}]}$$

=
$$24752.47525 N = 24.752kN$$

Since the bolts are subjected to direct shear and tensile load, so the equivalent tensile load

$$W_{te} = \frac{1}{2} \left[W_t + \sqrt{W_t^2 + 4 W_s^2} \right]$$

01 Mark

01 Mark



(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

 	(ISO/IEC - 2/001 - 2013 Certified)	
	$= \frac{1}{2} \left[24.75 + \sqrt{(24.75)^2 + 4(12.5)^2} \right]$	
	= 29.964. kN	01 Mark
	To find side of bolt	OI WIAIK
	$\sigma_{\rm t} = \frac{W_{\rm te}}{\frac{\pi}{4} d_{\rm c}^2}$	
	$80 = \frac{29.964 \times 10^3}{\frac{\pi}{4} \times d_c^2}$	
	$d_c^2 = 476.899$	
	$d_c = 21.838 \text{ mm}$	
	Nominal diameter of bolt = $\frac{d_c}{0.84}$ = 25.997	
	≅ 26 mm The size of bolt = M26	01 Mark
(b)	Explain with neat sketch construction of leaf spring.	04 marks
Ans	 Semi-elliptical leaf springs are widely used for suspension in light and heavy commercial vehicle. In car these are used for rear suspension. The leaf springs are made of flat semi-elliptical plate. The advantage of leaf spring over helical spring is that the ends of the spring may be guided along the definite path as it deflects to acts as a structural member in addition to energy absorbing device. Thus, leaf spring carry lateral load, brake torque, driving thrust and shocks. It consists of number of semi-elliptical plates called blade or leaves. The leaves are given initially curvature or camber so that they tend to straighten under the load. The blades vary in length and are held together by a bolt passing through the center acting as a beam of uniform strength. The spring is clamped to the axle housing by means of 'U' bolts. The longest leave is known as master leaves, has its end formed in the shape of an eye through which the bolts are passed to secure the spring to its supports. 	02 Mark for construction
	• The eyes are a tacket for tackle provided with bushing of citi-frection mae ial such as	

(Autonomous)

(ISO/IEC - 27001 - 2013 Certified)


bronze or rubber. The other leaves are graduated leaves. To prevent digging in the adjacent leaves, the ends of graduated leaves are trimmed in various forms. The master leaf has to withstand vertical bending load, side thrust and twisting moment due to presence of stresses caused by these loads so it is usual to provide two full length leaves and rest graduated leaves. Rebound clips are located at intermediate position in the length of the spring so that graduated leaves also shear the stresses induced in the full-length leaves when the spring rebound. Highly cambered spring provides a 50% suspension but they also increase tendency to jaw (movement about vertical axis). Flat spring reduces tendency of the vehicle to dip (pitching), when brake or accelerate suddenly. Use of longer spring gives soft suspension. Generally rear spring are kept longer than the front spring. This causes them to vibrate at different frequencies, which prevent excessive bounce. Shackle Frame side member Spring eye U - bolt Rubber bush 2 Mark for Master leaf dia. Clip or strap Central bolt (Rebound dip) (c) Explain with neat sketch the bolts of uniform strength. 04 marks Ans (a) Shank 01 Mark (c) (b) When bolt is subjected to shock load i.e. power hammer, connecting rod, presses, etc. In such cases the bolt is designed to absorb impact load and to resist the torque to prevent the breakage of thread. In ordinary bolt fig (a) the effect of load concentrated on the weakest part 01 Mark of the bolt i.e. c/s area of the root of the thread. The stress in the threaded part will be more as compared to the shank hence the maximum portion of energy will be absorbed at the region

Page No: / N

(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

	of the threaded which may fracture the threaded protion.	
	If the diameter of the shank of the bolt is turned to the core diameter of the thread as shown in fig (b) then the shank of the bolt will undergo a higher stress. This means that shank will absorb large portion of energy thus relieving the material at the threaded protion. The bolt in this way became stronger and lighter and it increases the impact load carrying capacit. This gives us bolts of uniform strength.	01 Mark
	Another method, an axial jole is drilled through the head of the bolt as far as threaded portion; such the area of the shank became equal to the root area of the thread.	
	D = Diameter of hole.	
	d_o = Outside Diameter.	01 Mark
	d_c = Core Diameter.	
	$\frac{\pi}{4}D^2 = \frac{\pi}{4}(d_o^2 - d_c^2)$	
	$D = \sqrt{{d_o}^2 - {d_c}^2}$	
(d)	Explain the procedure of selection of ball bearing using manufacturer's catalogue.	04 Marks
Ans	1) Calculate radial and axial forces and determine dia. of shaft.	
	2) Select proper type of bearing.	
	3) Start with extra light series for given diagram go by trial of error method	
	4) Find value of basic static capacity (co) of selected bearing from catalogue.	
	4) Find value of basic static capacity (co) of selected bearing from catalogue.5) Calculate ratios Fa/VFr and Fa/Co.	
	5) Calculate ratios Fa/VFr and Fa/Co.	
	5) Calculate ratios Fa/VFr and Fa/Co.6) Calculate values of radial and thrust factors.(X & Y) from catalogue.	½ mark for
	 5) Calculate ratios Fa/VFr and Fa/Co. 6) Calculate values of radial and thrust factors.(X & Y) from catalogue. 7) For given application find value of load factor Ka from catalogue. 	½ mark for each step
	 5) Calculate ratios Fa/VFr and Fa/Co. 6) Calculate values of radial and thrust factors.(X & Y) from catalogue. 7) For given application find value of load factor Ka from catalogue. 8) Calculate equivalent dynamic load using relation. Pe = (XVFr + YFA) Ka. 9) Decide expected life of bearing considering application. Express life in million 	
	 5) Calculate ratios Fa/VFr and Fa/Co. 6) Calculate values of radial and thrust factors.(X & Y) from catalogue. 7) For given application find value of load factor Ka from catalogue. 8) Calculate equivalent dynamic load using relation. Pe = (XVFr + YFA) Ka. 9) Decide expected life of bearing considering application. Express life in million revolutions L10 	

(Autonomous) (ISO/IEC - 27001 - 2013 Certified)

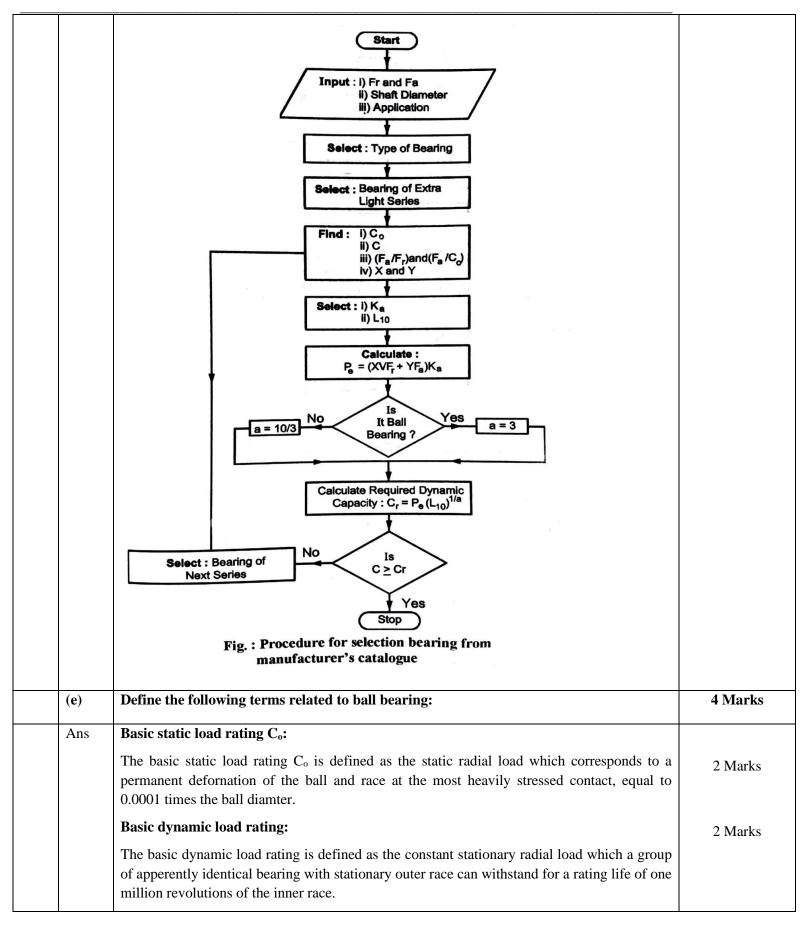

www.truexams.com